Comfort Station 4 at 110 Freezer Road



Town of Barnstable ADA Transition Plan

July 2021



200 Portland Street, Boston, MA 02114 www.IHCDesign.org • info@IHCDesign.org 617-695-1225 voice/ tty

Background

At the Comfort Station located at 110 Freezer Road, there are three (3) accessible parking spaces provided on the south side of the structure. The Comfort Station has one (1) men's and one (1) women's multi-user toilet room that each also have a shower.

Key Accessibility Issues

Exterior Accessible Routes

Accessibility issues with exterior routes include cross slopes that are greater than the maximum allowed, excessive changes in level and surfaces that are not stable, firm and slip-resistant. In addition, surfaces do not prevent accumulation of water.

Parking

Accessibility issues include lack of a van accessible designation sign at the van accessible parking space and an access aisle that is narrower than the minimum width required. In addition, there is a lack of two (2) identification signs with the International Symbol of Accessibility (ISA), and an existing identification sign is installed higher than the maximum height allowed.

Toilet Rooms

Accessibility issues include the toilet seat located further from the side wall than the maximum allowed (men's), grab bars are installed lower than the minimum allowed, and compartment doors lack compliant hardware. In addition, toe and knee clearance is not provided at the men's lavatory and clear floor space is not provided at the women's lavatory. Plumbing underneath both men's and women's lavatories are exposed, and the urinal is installed higher than the maximum height allowed. Additional issues include coat hooks that are installed higher than allowed, noncompliant toilet paper dispensers, hand dryers that protrude into the circulation path, and lack of an audible and visible alarm in each toilet room.

Showers Rooms:

Accessibility issues at both shower rooms include lack of an accessible transfer shower and changing area.

Additional Accessibility Issues

- Thresholds are higher than the maximum allowed.
- Hardware not operable with closed fist.
- Raised character and braille not provided on signs.

Order of Magnitude Cost Estimates

- Renovate exterior accessible routes: \$3,840
- Renovate parking: \$1,800
- Renovate toilet rooms: \$10,808
- Renovate showers: \$27,636
- Miscellaneous corrective actions (signage, thresholds, hardware, etc.): \$2,196

Total: \$46,280

ID	Location	Floor Room	Element	Туре	Photo	Issues	Current Measure	Recommendations	Quantity	Price	Cost Estimation				
A	Approach and E	Entrance													
	Exterior Access Route														
1	Path to Comfort Station	Ext.	Exterior Access Route	Walkway		ss slope > 1:50 (2.00%) ace is not stable, firm, and slip-resistant	4.9%	Reduce cross slope to be no steeper than 1:50 (2.00%). Repair surface. (Cost provided in ID #3.)	1	-	\$0				
2	Path to Comfort Station	Ext.	Exterior Access Route	Walkway		I changes > 1/4" s not prevent accumulation of water	1.5" -	Alter change in level to be 1/4" high max. Repair surface. (Cost provided in ID #3.)	1	-	\$0				
3	Path to Comfort Station	Ext.	Exterior Access Route	Walkway	Surf	ace is not stable, firm, and slip-resistant	-	Repair surface. (Cost for a 4' wide by 60' long concrete path.)	1	3840	\$3840				
4	Path to Comfort Station	Ext.	Exterior Access Route	Walkway	Surf	ace is not stable, firm, and slip-resistant	-	Repair surface. (Cost provided in ID #3.)	1	-	\$0				
	Off-Street Par	rking Lot or Gara	age												
5	Parking Lot	Ext.	Off-Street Parking Lot or Garage	Visitor	Total Total Acce	I # of parking I # of designated accessible parking spaces I # of designated van accessible spaces ess aisle < 96" wide at van space not provided	5 2 1 90" -	Provide a marked access aisle that is at least 96" wide. Provide two (2) signs with the International Symbol of Accessibility (ISA) with the bottom of the sign 60" minimum above the ground and the	1	1800	\$1800				

Access to Goods and Services

102.5"

top 96" max. above the ground.

located at the van accessible space.

Add the designation "Van Accessible" to the sign

Locate top of sign 96" max. above the ground.

Sign does not have the designation "Van Accessible" Sign top > 96" above finished grade

ID	Location	Floor	Room	Element	Туре	Photo	Issues	Current Measure	Recommendations	Quantity	Price	Cost Estimation	
	Doors, Doorways, & Gates												
6	Women's Toilet Room	Ext.		Doors, Doorways, & Gates	Toilet Room	T	hreshold > 1/2" high	1.25"	Alter the threshold to be 1/2" high max.	1	150	\$150	
7	Women's Shower	1		Doors, Doorways, & Gates	Shower Compartme nt	T	hreshold > 1/2" high	4"	Alter the threshold to be 1/2" high max. (Cost provided in ID #25.)	1	-	\$0	
8	Men's Shower	1		Doors, Doorways, & Gates	Shower Compartme nt	TI	hreshold > 1/2" high	4"	Alter the threshold to be 1/2" high max. (Cost provided in ID #26.)	1	-	\$0	
9	Men's Toilet Room	Ext.		Doors, Doorways, & Gates	Toilet Room	T	hreshold > 1/2" high	1.5"	Alter the threshold to be 1/2" high max.	1	150	\$150	
10	Women's Shower	1			Shower Compartme nt	Ha	ardware not operable with a closed fist	-	Provide hardware that can be operable with one hand and not require tight grasping, pinching, or twisting of the wrist.	1	484	\$484	

Town of Barnstable

Comfort Station at 110 Freezer Road

ID	Location	Floor Ro	oom Element	Туре	Photo	Issues	Current Measure	Recommendations	Quantity	Price	Cost Estimation
	Men's Shower	1	Doors, Doorways, & Gates	Shower Compartme nt		Hardware not operable with a closed fist	-	Provide hardware that can be operable with one hand and not require tight grasping, pinching, or twisting of the wrist.	1	484	\$484
	Signage										
	Men's Toilet Room	Ext.	Signage	Designation		Raised characters not provided on sign Braille not provided on sign	- -	Provide text with raised characters duplicated in braille on sign.	1	232	\$232
13	Men's Shower	1	Signage	Designation		Raised characters not provided on sign Braille not provided on sign	- -	Provide text with raised characters duplicated in braille on sign.	1	232	\$232
14	Women's Toilet Room	Ext.	Signage	Designation		Raised characters not provided on sign Braille not provided on sign	-	Provide text with raised characters duplicated in braille on sign.	1	232	\$232
	Women's Shower	1	Signage	Designation		Raised characters not provided on sign Braille not provided on sign		Provide text with raised characters duplicated in braille on sign.	1	232	\$232

Toilet & Bathing Rooms

							Measure	Recommendations	Quantity	Price	Estimation		
Overall Access													
Men's Toilet Room	1		Overall Access	Toilet Room		Audible and visible alarms not provided	-	When fire system is updated, ensure that a visible and audible fire alarm is installed. (Cost of fire systems is not provided.)	1	-	\$0		
Women's Toilet Room	1		Overall Access	Toilet Room		Audible and visible alarms not provided	-	When fire system is updated, ensure that a visible and audible fire alarm is installed. (Cost of fire systems is not provided.)	1	-	\$0		
Lavatory													
Women's Toilet Room	1		Lavatory	N/A		Clear floor space not provided at lavatory Toe or knee clearances not provided Dispenser acts as a protruding object Plumbing underneath is exposed	28" 26" - 9.5"	Provide a lavatory with a 30" min. by 48" min. clear floor space positioned for a forward approach. Provide a lavatory with knee and toe clearance positioned for a forward approach. Relocate dispenser out of the circulation path. Insulate or otherwise configure pipes to prevent contact for at least one lavatory.	1	2034	\$2034		
Men's Toilet Room	1		Lavatory	483	P	Plumbing underneath is exposed Dispenser acts as a protruding object	- 9.5"	Insulate or otherwise configure pipes to prevent contact for at least one lavatory. Relocate dispenser out of the circulation path.	1	348	\$348		
Toilet Compa	rtment												
Men's Toilet Room	1		Toilet Compartme nt	Accessible Compartme nt		Door has non-compliant hardware Coat hook > 48"	-	Provide hardware that can be operable with one hand and not require tight grasping, pinching, or twisting of the wrist. Lower coat hook so that it is no higher than 48".	1	220	\$220		
	Women's Toilet Room Women's Toilet Room Men's Toilet Room Foilet Compa	Men's Toilet Room Women's Toilet Room Avatory Women's 1 Toilet Room Men's Toilet 1 Men's Toilet 1	Men's Toilet Room Women's Toilet Room Avatory Women's 1 Toilet Room Men's Toilet 1 Room Foilet Compartment Men's Toilet 1	Men's Toilet Room	Men's Toilet Room Women's Toilet Room Access Toilet Room Women's Toilet Room Lavatory Women's 1 Lavatory N/A Men's Toilet Room Toilet Compartment Men's Toilet 1 Toilet Compartment	Men's Toilet Room Women's 1 Overall Access Toilet Room Women's Toilet Room Access Toilet Room Access Toilet Room Men's Toilet Room Men's Toilet Room Men's Toilet Room Toilet Compartment Men's Toilet Room Men's Toilet Room Toilet Compartment Men's Toilet Room Toilet Compartment Men's Toilet Room	Men's Tollet 1 Coverall Access Tollet Room Audible and visible alarms not provided Women's Tollet Room 1 Coverall Access Tollet Room Audible and visible alarms not provided Access Clear floor space not provided at lavatory Tollet Room 1 Lavatory N/A Clear floor space not provided Dispenser acts as a protruding object Plumbing underneath is exposed Plumbing underneath is exposed Dispenser acts as a protruding object Plumbing underneath is exposed Plumbing underneath is exposed Dispenser acts as a protruding object Tollet Compartment Accessible Compartme Compartme Door has non-compliant hardware Coet hook > 48°	Men's Tollet Room 1	Mem's Totel 1 Access Totel Room Audible and visible alarms not provided - When fire system is updated, ensure that a visible and audible fire alarms is installed. (Cost of fire system is not provided.) Women's Totel Room 1 Coverall Access Totel Room Audible and visible alarms not provided - When fire system is updated, ensure that a visible and audible fire alarms is installed. (Cost of fire system is updated, ensure that a visible and audible fire alarms is installed. (Cost of fire system is updated, ensure that a visible and audible fire alarms is installed. (Cost of fire system is not provided.) Access Totel Room 1 Lavatory NA Description of the control of the cost of fire system is not provided. (Cost of fire system is not provided.) Description of the cost of fire system is not provided. (Cost of fire system is not provided.) Description of the cost of fire system is not provided. (Cost of fire system is not provided.) Description of the cost of fire system is not provided. (Cost of fire system is not provided.) Description of the cost of fire system is not provided. (Cost of fire system is not provided.) Description of fire system is not provided. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of provided at lavatory. (Cost of fire system is not provided.) Description of fire system is not provided. (Cost of fire	Month Tollet 1 Access Tollet Room Access Tollet Room Audible and visible alarms not provided - When fire system is updated, ensure that a visible and audible fire alarm is installed. (Cost of fire systems is not provided) Women's Tollet Room 1 Tollet Room Audible and visible alarms not provided - When fire system is updated, ensure that a visible and suitible and visible alarms not provided - When fire system is updated, ensure that a visible and suitible fire alarm is installed. (Cost of fire system is updated, ensure that a visible and suitible fire alarm is installed. (Cost of fire system is not provided.) Women's Tollet Room 1 Lavadory NA Clear Room space not provided at lavadory Toe or knee clearances not provided 22° of a for a space positioned for a forward approach. Tollet Room 1 Lavadory Purricing underneath is exposed 9.5-T Provide a lavadory with not not approach. Special provided all systems are provided approach. Special provided and systems are provided and systems are provided.) Men's Tollet 1 Lavadory 483 Purricing underneath is exposed 9.5-T Room I lavador on division or all seal on on browner configure pipes to prevent contact for all least one browner. Provides a lavadory with not not all read one browner. Provides a lavadory with a soft many approach in a least one browner. Provides a lavadory with not not all read one browner. Provides a lavadory with not not approach approach in all lavadors on dispute pipes to prevent contact for all least one browner. Provides a lavadory. Relocate disponser out of the circulation path. **Tollet Compartment** **Men's Tollet Compartment**	Merin Tollet Normal Coverall Coverall		

ID	Location	Floor	Room	Element	Type	Photo	Issues	Current Measure	Recommendations	Quantity	Price	Cost Estimation
21	Women's Toilet Room	1		Toilet Compartme nt	Accessible Compartme nt		Door has non-compliant hardware Coat hook > 48"	-	Provide hardware that can be operable with one hand and not require tight grasping, pinching, or twisting of the wrist. Lower coat hook so that it is no higher than 48".	1	220	\$220
22	Women's Toilet Room	1		Toilet Compartme nt	Accessible Compartme nt		Side or rear grab bar < 33" or >36" high . Flush control not on open side . Non-compliant toilet paper dispenser	31" - -	Locate grab bars between 33"- 36" above the finished floor. Provide the flush control on the open side of the toilet (transfer side). Relocate toilet paper so that it is 24" minimum high, located under the grab bar, and between 7" and 9" from the front of the toilet.	1	1142	\$1142
23	Men's Toilet Room	1		Toilet Compartme nt	Accessible Compartme nt		Side or rear grab bar < 33" or >36" high Non-compliant toilet paper dispenser Centerline < or > 18" (MAAB)	31.25" - 19"	Locate grab bars between 33"- 36" above the finished floor. Relocate toilet paper so that it is 24" minimum high, located under the grab bar, and between 7" and 9" from the front of the toilet. Relocate toilet so the centerline is 18" from the side wall.	1	3596	\$3596
	Urinal											
24	Men's Toilet Room	1		Urinal	N/A		Rim > 17" high Flush control too high or not properly located	25.75" 54"	Provide at least one urinal with the rim no higher than 17" above the finished floor. Mount flush control at 44" maximum above the finished floor.	1	3248	\$3248
	Shower Comp	partmen	t									
25	Women's Shower	1		Shower Compartme nt	N/A		Accessible shower not provided	-	Provide one (1) accessible shower. (Cost based on a transfer shower.)	1	6072	\$6072

Town of Barnstable

Comfort Station at 110 Freezer Road

ID	Location	Floor Room	Element	Туре	Photo	Issues	Current Measure	Recommendations	Quantity	Price	Cost Estimation
26	Men's Shower	1	Shower Compartme nt	N/A		. Accessible shower not provided	-	Provide one (1) accessible shower. (Cost based on a transfer shower.)	1	6072	\$6072
	Changing Roo	ms									
27	Women's Changing Room	1	Changing Rooms	Women's		Room is < 78" x 72" 30" clear not provided alongside bench Bench < 24" deep Bench < 48" long	25.75" - - -	Provide an accessible changing room that is 78" by 72" minimum. Provide a 30" by 48" minimum clear space along the side of the bench so that wheelchair users can transfer. Provide a bench that is 24" deep and 48" long minimum.	1	5866	\$5866
28	Men's Shower Changing Room	1	Changing Rooms	Men's		Room is < 78" x 72" 30" clear not provided alongside bench Bench < 24" deep Bench < 48" long	- 24.75" - -	Provide an accessible changing room that is 78" by 72" minimum. Provide a 30" by 48" minimum clear space along the side of the bench so that wheelchair users can transfer. Provide a bench that is 24" deep and 48" long minimum.	1	5866	\$5866
29	Women's Shower Changing Room	1	Changing Rooms	Women's		. Hook > 48" high	63.75"	Locate hook no higher than 48" above the finished floor. (Cost provided in ID #25.)	1	-	\$0
30	Men's Changing Room	1	Changing Rooms	Men's		. Hook > 48" high	63.75"	Locate hook no higher than 48" above the finished floor. (Cost provided in ID #26.)	1	-	\$0