# Hyannis Youth & Community Center



#### **ADA Transition Plan**

October 2021



Institute for Human Centered Design

www.IHCDesign.org • info@IHCDesign.org 617-695-1225 voice/ tty

#### Background

Hyannis Youth & Community Center (HYCC) is located at 141 Bassett Lane. The HYCC is a community center that primarily services the youth of the Town of Barnstable including the school district's athletic departments, after-school programs, hockey and figure skating competitive organizations and community groups, and children whose families reside within a one-mile radius of the HYCC. Amenities include two (2) NHL size rinks, a gymnasium with a mezzanine level running track, a teen center, a computer room, a pro-shop, a community room, a resource room, a conference room, a café, locker rooms and multi-user toilet rooms. Additional amenities include a professional skate park, a parking lot and bus stop within the premise. The HYCC is available for daily rentals or long-term contract.

The building has two (2) floors and an additional mezzanine level in the gymnasium with a running track. The running track can be accessed by an elevator or stairs (#3 & #4). The mezzanine level, upper level and the lower level are all connected by an elevator. There are two (2) egress stairs one near the Scudder Family Café and the other on the west side of the building near the sky box. The main entrance/exit to the building is located on the upper level near the pick-up and drop-off zone. There are two (2) additional exits on the upper level from the gymnasium (south side) and another from the Kennedy Ice Rink near the sound box (north side). Three (3) other exits are located on the lower level west side of the building at the Kennedy Ice Rink.

The Kennedy Ice Rink has a seating capacity of 1493 persons, a lift provides an accessible route to the lower level seating.

There are two (2) of each men's and women's multi-user toilet rooms located on the upper level (1). The lower level (L) has one (1) men's and one (1) women's toilet room at the lower lobby. Additional toilet rooms and shower compartments are provided at the four (4) locker rooms with locker rooms 1-2 & 1-3 sharing them.

The parking lot is located on the north and east sides of the building. There are 229 parking spaces including (8) accessible parking spaces.

Note: The Hyannis Youth & Community Center has two (2) ice rinks located on north and south side of the building. For purposes of Program Accessibility, IHCD recommends that the Town ensure that the Kennedy Ice Rink, being the larger of the two ice rinks and having a lift that provides an accessible route to the lower level be made accessible. (See floor plans below with the areas recommended to be made accessible.)

A study is needed to determine the feasibility of providing an accessible route to the team seating, penalty box and press box at the Kennedy Ice Rink. In the interim, IHCD recommends using the Zamboni entrance to provide an accessible route to the rink.

#### Areas recommended to be made accessible



#### **Key Accessibility Issues**

Exterior Accessible Routes Accessibility issues at the exterior accessible routes include excessive change in level at walkways, cross walks not maintained in operable working condition, lack of an accessible route from the exit at gymnasium to the bus stop.

#### Hyannis Youth & Community Center

#### Kennedy Ice Rink

Accessibility issues at the Kennedy Ice Rink include excessive change in level at the Zamboni entrance, lack of minimum 36" clear width at the accessible route to the exits on the west side of Kennedy Ice Rink, and lack of an accessible route to the team seating, penalty box and press box, Other accessibility issues include lack of an assistive listening system and lack of shoulder alignment with adjacent benches at the wheelchair accessible spaces (ice rink).

**Note:** In assembly areas where audible communication is integral to the use of the space, an assistive listening system shall be provided. Assistive listening systems shall be identified by the International Symbol of Access for Hearing Loss.

#### Signage

Accessibility issues include lack of compliant designation signage (with braille and raised characters), lack of tactile egress signs (with braille and raised characters) and lack of directional signs at the inaccessible exits directing public to the accessible exits.

#### Locker Rooms

Accessibility issues include lack of compliant hardware at the official's locker rooms, lack of clear floor space at the accessible lockers, lack of compliant benches, and lack of a clear floor space adjacent to bench. Other accessibility issues include stickers with the ISA that lack maintenance, storage shelf and coat hooks that are located higher than maximum allowed.

#### Toilet Rooms & shower compartments

Accessibility issues include lack of a compliant accessible compartment at the men's toilet room (231), lack of knee clearance at the lavatories, lack of insulated pipes at the lavatories, lack of self-closing door at the accessible compartments and lack of 18" centerline to toilet from side wall at women's toilet room (225).

Accessibility issues at the transfer showers in the locker rooms include lack of a fixed showerhead and lack of clear floor space at lockers 1-2 & 1-3 (shared shower).

Accessibility issues at the official's locker rooms include lack of grab bars at the transfer showers (112,113) and lack of a padded folding seat (men's locker room (113)).

#### Additional Accessibility Issues

- Excessive opening force at various interior doors.
- Lack of maneuvering clearance at the door to the sky box.
- Identification signs at the parking lot that are higher than the maximum height allowed and lack of a van accessible parking space.
- Lack of audible hall signals at the elevator.
- Lack of cane-detectable barriers for protruding objects.
- Lack of compliant handrails at the interior stairs.
- Lack of handrails at exterior stairs.
- Lack of accessible service counters.
- Coat hooks, brochures, etc. located higher than maximum allowed.
- Lack of an accessible work surface with knee clearance (teen center).
- Lack of an assistive listening system at the conference room.
- Lack of drinking fountains for standing users (lower lobby).

#### **Order of Magnitude Cost Estimates**

- Renovate toilet rooms and locker rooms: \$25,188
- Provide assistive listening system at the Kennedy Ice Rink and conference room: \$11,079
- Provide accessible service counters: \$4,400
- Provide drinking fountain for standing users: \$8,056
- Provide compliant signage (designation, egress and directional): \$7.924
- Provide or renovate handrails at interior and exteriors stairs: \$5,762
- Miscellaneous corrective actions (doors, protruding objects, elevator hall signals, etc.): \$10,336

#### Total: \$72,745\*

\*Note: Costs to provide an accessible route to team seating, penalty box, press box and clear floor space with shoulder alignment at Kennedy Ice Rink are not included.

#### **Best Practice and Inclusive Design**

Best practice and inclusive design recommendations include elements that are not required in the standards but may create enhanced experiences for all users.

- step at all the stairs.
- Ice Rink.

• Provide an adjustable lantern with 27" min. knee clearance at the Shepley Community Room.

• Recommend adding contrasting strips at the edge of each

 Provide a sign with the International Symbol of Accessibility (ISA) at the accessible entrances to the Kennedy Ice Rink.

Provide a directional sign at the Butlers Ice Rink indicating the location of the nearest accessible entrance to the Kennedy

If the exit sign is replaced with an illuminated exit sign, provide an illuminated International Symbol of Accessibility (ISA) at the exit west of Kennedy Ice Rink.

• Recommend providing a 36" min. x 48" min. clear floor space adjacent to the bench located along the exterior accessible route near Bassett Lane.

• Install a sign with a non-glare finish with characters that have a high contrast to the background at the Teen Center.



| ID | Location   | Floor Roon | n Element                   | Туре     | Photo                    | Issues  | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|--|------------|-----------------------------|----------|--------------------------|---|--------------------|---|----------|-------|--------------------|
| A  | Approach and I   | Entrance   |                             |          |                          |   |                    |   |          |       |                    |
|    | Exterior Acce  | ess Route  |                             |          |                          |   |                    |   |          |       |                    |
| 1  | Route to Bus<br>Stop/Skate<br>Park From<br>HYCC Main<br>Entrance                                     | Ext.       | Exterior<br>Access<br>Route | Walkway  | Level char               | nges > 1/4"   | 1.5"               | Alter change in level to be 1/4" high max.  | 1        | 256   | \$256              |
| 2  | Exit Near<br>Stair 2   | Ext.       | Exterior<br>Access<br>Route | Exterior | Level char               | nges > 1/4"   | 1"                 | Alter change in level to be 1/4" high max.  | 1        | 256   | \$256              |
| 3  | Crossing<br>North of<br>Entrance<br>from Parking   | Ext.       | Exterior<br>Access<br>Route | Exterior | Level char<br>Route not  | nges > 1/4"<br>maintained in operable working condition | .75"<br>-          | Alter change in level to be 1/4" high max.<br>Ensure the accessible route is maintained in<br>operable working condition. | 1        | 672   | \$672              |
| 4  | Route to Bus<br>Stop Near<br>Skate Park  | Ext.       | Exterior<br>Access<br>Route | Walkway  | Level chan<br>Accessible | nges > 1/4"<br>e route not provided                     | .75"<br>-          | Alter change in level to be 1/4" high max.<br>Ensure an accessible route is provided.                                     | 1        | 640   | \$640              |
| 5  | From<br>Accessible<br>Parking Lot to<br>Hyannis<br>Youth and<br>Community<br>Center Main<br>Entrance | Ext.       | Exterior<br>Access<br>Route | Exterior | Route not                | maintained in operable working condition                | -                  | Ensure the accessible route is maintained in operable working condition.  | 1        | 416   | \$416              |

| ID | Location                                       | Floor Room      | Element                                | Туре     | Photo | Issues  | Current<br>Measure | Recommendations  | Quantity | Price | Cost<br>Estimation |
|----|--|-----------------|--|----------|-------|---|--------------------|--|----------|-------|--------------------|
| 6  | Southeast<br>Emergency<br>Exit at<br>Gymnasium | Ext.            | Exterior<br>Access<br>Route            | Exterior |       | Accessible route not provided   | -                  | Ensure an accessible route is provided from the exit.  | 1        | 384   | \$384              |
|    | Off-Street Par                                 | king Lot or Gar | age                                    |          |       |   |                    |  |          |       |                    |
| 7  | Parking Lot                                    | Ext.            | Off-Street<br>Parking Lot<br>or Garage |          |       | Total # of parking<br>Total # of designated accessible parking spaces<br>Total # of designated van accessible spaces<br>Sign does not have the designation "Van Accessible" | 229<br>7<br>1<br>- | Add the designation "Van Accessible" to one of the accessible parking spaces.  | 1        | 500   | \$500              |
| 8  | Van<br>Accessible<br>Parking                   | Ext.            | Off-Street<br>Parking Lot<br>or Garage | Visitor  |       | Sign top > 96" above finished grade   | -                  | Locate sign with the top of the sign 96" above<br>the ground and ensure all signs are maintained<br>in operable working condition. | 1        | Labor | \$0                |

#### Access to Goods and Services

#### Means of Egress

| 9  | Entrance/Exit<br>to Kennedy<br>Ice Rink Near<br>Scudder<br>Family Cafe | 1 101 | Means of<br>Egress | N/A | actile exit sign not provided - | Ensure tactile exit signs with raised characters 1<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.   | 232 | \$232 |
|----|--|-------|--------------------|-----|---------------------------------|--|-----|-------|
| 10 | Exit Kennedy<br>Ice Rink Near<br>Sound Booth                           | 1 101 | Means of<br>Egress | N/A | actile exit sign not provided - | Ensure tactile exit signs with raised characters and braille are provided at exit doors. Mount signs between 48"- 60" above the finished floor located on the latch side of the door.<br>If the exit sign is replaced with an illuminated exit sign, provide an illuminated International Symbol of Accessibility (ISA). | 232 | \$232 |

| ID | Location  | Floor | Room | Element            | Туре | Photo | Issues                         | Current<br>Measure | Recommendations Qua   | uantity | Price | Cost<br>Estimation |
|----|---|-------|------|--------------------|------|-------|--------------------------------|--------------------|---|---------|-------|--------------------|
| 11 | Entrances/Exi<br>ts to Kennedy<br>Ice Rink<br>Along Hallway | 1     | 101  | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.<br>Recommendation applies to all egress doors<br>leading to corridor.  | 1       | 232   | \$232              |
| 12 | Kennedy Ice<br>Rink   | 1     | 101  | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.<br>Recommendation applies to all egress doors<br>leading to corridor.  | 6       | 232   | \$1392             |
| 13 | Exit<br>Northwest of<br>Kennedy Ice<br>Rink                 | L     | 101  | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.<br>If the exit sign is replaced with an illuminated exit<br>sign, provide an illuminated International Symbol<br>of Accessibility (ISA). | 1       | 232   | \$232              |
| 14 | To Referees<br>Lockers<br>Corridor                          | L     | 101  | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.  | 1       | 232   | \$232              |
| 15 | Recreation<br>Division                                      | 1     |      | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.  | 1       | 232   | \$232              |

| ID | Location  | Floor | Room I | Element            | Туре | Photo | Issues                         | Current<br>Measure | Recommendations G   | Quantity | Price | Cost<br>Estimation |
|----|---|-------|--------|--------------------|------|-------|--------------------------------|--------------------|---|----------|-------|--------------------|
| 16 | From<br>Referees to<br>First Aid  | L     |        | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.  | 1        | 232   | \$232              |
| 17 | Main<br>Entrance/Exit<br>to Hyannis<br>Youth and<br>Community<br>Center | 1     |        | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.<br>If the exit sign is replaced with an illuminated exit<br>sign, provide an illuminated International Symbol<br>of Accessibility (ISA).                                       | 1        | 232   | \$232              |
| 18 | Southeast<br>Emergency<br>Exit at<br>Gymnasium                          | 1     |        | Means of<br>Egress | 129  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.<br>After the exit is made accessible, If the exit sign<br>is replaced with an illuminated exit sign, provide<br>an illuminated International Symbol of<br>Accessibility (ISA). | 1        | 232   | \$232              |
| 19 | Entrance/Exit<br>to Reception<br>From<br>Gymnasium                      | 1     |        | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.  | 2        | 232   | \$464              |
| 20 | Corridor Near<br>Locker Room<br>1-1 &<br>Corridor Near<br>Locker 1-4    | L     |        | Means of<br>Egress | N/A  |       | Tactile exit sign not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.<br>Recommendation applies to all egress doors.   | 2        | 232   | \$464              |

| ID | Location   | Floor F  | Room Element                    | Туре | Photo | Issues   | Current<br>Measure | Recommendations 0   | Quantity | Price | Cost<br>Estimation |
|----|--|----------|---------------------------------|------|-------|--|--------------------|---|----------|-------|--------------------|
| 21 | Entrance/Exit<br>Kennedy Ice<br>Rink                   | L 1      | 01 Means of<br>Egress           | N/A  |       | Tactile exit sign not provided   | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.  | 1        | 232   | \$232              |
| 22 | Southwest<br>Emergency<br>Exit at<br>Gymnasium         | 1        | Means of<br>Egress              | N/A  |       | Tactile exit sign not provided<br>Directional sign to accessible exit not provided | -                  | Ensure tactile exit signs with raised characters<br>and braille are provided at exit doors. Mount<br>signs between 48"- 60" above the finished floor<br>located on the latch side of the door.<br>Provide a directional sign indicating the location<br>of the nearest accessible exit. | 1        | 464   | \$464              |
| 23 | Stair 2  | 1        | Means of<br>Egress              | N/A  |       | Directional sign to accessible exit not provided                                   | -                  | Provide a directional sign indicating the location<br>of the nearest accessible exit.   | 1        | 232   | \$232              |
|    | Interior Acces   | ss Route |                                 |      |       |  |                    |   |          |       |                    |
| 24 | Path<br>Between Exit<br>West of<br>Kennedy Ice<br>Rink | L 1      | I01 Interior<br>Access<br>Route | N/A  |       | Route < 36" wide   | 33"                | Ensure that a clear width of 36" min. is maintained at the accessible route.  | 1        | Labor | \$0                |
| 25 | Path to<br>Zamboni<br>Entrance<br>From Lockers         | L 1      | 140 Interior<br>Access<br>Route | N/A  |       | Route < 36" wide   | -                  | Ensure a clear width of 36" min. is maintained at the accessible route to the Zamboni entrance.   | 1        | Labor | \$0                |

| ID | Location                                       | Floor | Room        | Element                     | Туре | Photo | Issues                           | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|--|-------|-------------|-----------------------------|------|-------|----------------------------------|--------------------|---|----------|-------|--------------------|
| 26 | Shepley<br>Community<br>Room                   | 1     | 227         | Interior<br>Access<br>Route | N/A  |       | Obstructed by protruding objects | 7"                 | Provide a cane detectable barrier under TV monitor.   | 2        | 306   | \$612              |
| 27 | To Referees<br>Near Lift                       | L     | 101A        | Interior<br>Access<br>Route | N/A  |       | Obstructed by protruding objects | 9"                 | Provide a cane-detectable barrier under lift power box.   | 1        | 306   | \$306              |
| 28 | Girls' & Boys'<br>Toilet Room -<br>Teen Center | 1     | 214,<br>215 | Interior<br>Access<br>Route | N/A  |       | Obstructed by protruding objects | 10"                | Relocate paper towel dispenser so it does not protrude into circulation path.   | 2        | Labor | \$0                |
| 29 | Running<br>Track Lane                          | 1     |             | Interior<br>Access<br>Route | N/A  |       | Obstructed by protruding objects | 6.25"              | Relocate metal boxed objects between 27" - 80"<br>from finished floor.<br>Recommendation applies to all metal boxes<br>along the track. | 1        | Labor | \$0                |
| 30 | Brochure<br>Stand Near<br>Reception<br>Area    | 1     |             | Interior<br>Access<br>Route | N/A  |       | Obstructed by protruding objects | 6"                 | Relocate brochure holder boxes so it does not protrude into circulation path.   | 1        | Labor | \$0                |

| ID | Location  | Floor          | Room                | Element                        | Туре  | Photo | Issues                                  | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|---|----------------|---------------------|--------------------------------|-------|-------|---|--------------------|---|----------|-------|--------------------|
| 31 | Lower Lobby   | L              | 103                 | Interior<br>Access<br>Route    | N/A   |       | Obstructed by protruding objects        | 7"                 | Provide a cane-detectable barrier under first aid.  | 1        | 306   | \$306              |
| 32 | Zamboni<br>Entrance at<br>Ice Rinks<br>Doors, Doorw             | L<br>rays, & ( | 140<br>Gates        | Interior<br>Access<br>Route    | N/A   |       | Level changes > 1/4"                    | 1.25"              | Alter change in level to be 1/4" high max.  | 1        | 150   | \$150              |
| 33 | Sky Box -<br>Kennedy Ice<br>Rink                                | 1              | 242                 | Doors,<br>Doorways,<br>& Gates | Other |       | Maneuvering clearance(s) not provided   | -                  | Relocate cabinet to maintain the maneuvering clearance at the door.   | 1        | Labor | \$0                |
| 34 | Entrances/<br>Exits to<br>Kennedy Ice<br>Rink Along<br>Corridor | 1              | 221,<br>222,<br>223 | Doors,<br>Doorways,<br>& Gates | Other |       | Door requires > 5 lbs. of force to open | 10 lbs.            | Adjust closers so doors do not require more than<br>5 pounds of force to open.<br>Recommendation applies to all interior doors<br>accessed by public. | 1        | Labor | \$0                |
| 35 | Teen Center<br>Entrance/Exit                                    | 1              | 210                 | Doors,<br>Doorways,<br>& Gates | Other |       | Door requires > 5 lbs. of force to open | 17 lbs.            | Adjust closers so doors do not require more than<br>5 pounds of force to open.<br>Recommendation applies to all interior doors<br>accessed by public. | 1        | Labor | \$0                |

| ID | Location                                       | Floor | Room | Element   | Туре  | Photo | Issues   | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|--|-------|------|-----------|-------|-------|--|--------------------|---|----------|-------|--------------------|
|    | Stairways                                      |       |      |           |       |       |  |                    |   |          |       |                    |
| 36 | Northwest<br>Stair Near<br>Kennedy Ice<br>Rink | Ext.  |      | Stairways | Other |       | Handrail height < 34" or > 38"<br>Handrail not provided on both sides  | 33"<br>-           | Alter so the handrails are 34"- 38" high above<br>the floor.<br>Ensure handrail is provided on both sides.<br>(Cost of providing one 5 foot long handrail.)   | 1        | 370   | \$370              |
| 37 | Kennedy Ice<br>Rink                            | 1     | 101  | Stairways | Other |       | Handrails do not extend 12" from stairs                                | -                  | Top: Ensure handrails extend horizontally above<br>the landing for 12" min. beginning above the first<br>riser nosing. Bottom: Ensure handrails extend to<br>one tread depth beyond the last riser.<br>Recommendation applies to all stair handrails<br>where applicable. | 1        | 800   | \$800              |
| 38 | Stair 3 -<br>Gymnasium                         | 1     |      | Stairways | Other |       | . Handrails do not extend 12" from stairs                              | -                  | Bottom: Ensure both handrails extend 12"<br>beyond the last riser.<br>Recommendation applies to all stairs.   | 2        | 800   | \$1600             |
| 39 | Stair 4 -<br>Gymnasium                         | М     |      | Stairways | Other |       | Handrails do not extend 12" from stairs                                | 6"                 | Top: Ensure handrails extend horizontally above<br>the landing for 12" min. beginning above the first<br>riser nosing.<br>Recommendation applies to all stairs.   | 2        | 800   | \$1600             |
| 40 | Stair North of<br>building Near<br>Parking     | Ext.  |      | Stairways | Other |       | Not maintained in operable working condition<br>Handrails not provided | -                  | Ensure stairs are maintained in operable<br>working condition.<br>Provide handrails on both sides of stair.<br>(Cost of providing two 4 foot long handrail.)  | 2        | 296   | \$592              |

| ID | Location  | Floor | Room | n Element | Туре        | Photo    | Issues   | Current<br>Measure | Recommendations  | Quantity | Price | Cost<br>Estimation |
|----|---|-------|------|-----------|-------------|----------|--|--------------------|--|----------|-------|--------------------|
| 41 | Stair 1 Near<br>Scudder<br>Family Cafe          | 1     |      | Stairways | Other       |          | Handrails do not return properly   | -                  | Ensure that handrail extensions return to a wall,<br>guard, or the landing surface, or shall be<br>continuous to the handrail of an adjacent stair<br>flight.  | 1        | 800   | \$800              |
|    | Elevator  |       |      |           |             |          |  |                    |  |          |       |                    |
| 42 | Elevator  | 1     |      | Elevator  | Interior    |          | . Audible hall signals not provided  | -                  | Install a audible hall signals.  | 1        | 1772  | \$1772             |
|    | Signage   |       |      |           |             |          |  | 1                  |  |          |       |                    |
| 43 | Kennedy Ice<br>Rink<br>Entrance<br>Near Lockers | 1     |      | Signage   | Directional |          | Signage is not provided<br>Directional sign to accessible entrance not provided  | -                  | Locate compliant signage alongside the door on<br>the latch side.<br>Provide a directional sign indicating the location<br>of the Zamboni entrance and provide information<br>on assistance. Ensure same information is<br>provided on the web site. | 2        | 464   | \$928              |
| 44 | Referees<br>Near First Aid                      | L     | 101A | Signage   | Designation | REFEREES | Raised characters not provided on sign<br>Braille not provided on sign<br>Sign not located on the latch side of the door |                    | Provide text with raised characters duplicated in<br>braille on sign.<br>Locate sign at permanent rooms alongside the<br>door on the latch side.   | 1        | 232   | \$232              |
| 45 | Teen Center<br>Entrance/Exit                    | 1     | 210  | Signage   | Designation |          | Raised characters not provided on sign<br>Braille not provided on sign<br>Sign not located on the latch side of the door | -<br>-<br>-        | Provide text with raised characters duplicated in<br>braille on sign.<br>Locate sign to the right of the right hand door.  | 1        | 232   | \$232              |

| ID | Location  | Floor | Room            | Element | Туре        | Photo  | Issues   | Current<br>Measure | Recommendations Qu  | uantity | Price | Cost<br>Estimation |
|----|---|-------|-----------------|---------|-------------|--|--|--------------------|---|---------|-------|--------------------|
| 46 | Entrance<br>Kennedy Ice<br>Rink                     | L     | 103             | Signage | Designation | L'AGEN P. ICHNODY JO<br>REDORAL SCATHORING<br>122<br>134 | Raised characters not provided on sign<br>Braille not provided on sign<br>Sign not located on the latch side of the door   |                    | Provide text with raised characters duplicated in<br>braille on sign.<br>Locate sign at permanent rooms alongside the<br>door on the latch side.  | 1       | 232   | \$232              |
| 47 | Exits From<br>Kennedy Ice<br>Rink Along<br>Corridor | 1     | 221,222<br>,223 | Signage | Directional |  | Directional sign to accessible entrance not provided   | -                  | Provide a directional sign indicating the location<br>of the nearest accessible entrance.<br>Recommendation applies to all exit doors along<br>hallway and at entrances that are not accessible.  | 7       | 232   | \$1624             |
| 48 | Entrance/Exit<br>Butler Ice<br>Rink                 | L     | 103             | Signage | Designation | PATRICK M. BUTLER<br>SKATING RINK                        | Directional sign to accessible entrance not provided<br>Raised characters not provided on sign<br>Braille not provided on sign<br>Sign not located on the latch side of the door | -                  | Provide text with raised characters duplicated in<br>braille on sign.<br>Locate sign at permanent rooms alongside the<br>door on the latch side.<br>Provide a directional sign indicating the location<br>of the nearest accessible entrance. | 1       | 232   | \$232              |
| 49 | The United<br>Cultures<br>Resource<br>Room          | 1     | 217A            | Signage | Designation |  | . Sign not located on the latch side of the door   | -                  | Locate sign at permanent rooms alongside the<br>door on the latch side.<br>Recommendation applies to all rooms open to<br>public with permanent designation sign.   | -       | Labor | \$0                |
| 50 | Pro-Shop  | 1     | 217             | Signage | Designation |  | Sign not located on the latch side of the door   | -                  | Locate sign to the right of the right hand door leaf.   | 1       | Labor | \$0                |

| ID | Location                               | Floor Roo | om Element         | Туре        | Photo | Issues              | Current<br>Measure | Recommendations Qu   | uantity | Price | Cost<br>Estimation |
|----|--|-----------|--------------------|-------------|-------|---------------------|--------------------|--|---------|-------|--------------------|
| 51 | Locker Room<br>1-1, Locker<br>Room 4-4 | L         | Signage            | Designation |       | Sign not maintained |                    | Ensure ISA (International Symbol of<br>Accessibility) sign is maintained at all accessible<br>lockers. | 4       | -     | \$0                |
|    | Service Coun                           | ter       |                    |             |       |                     |                    |  |         |       |                    |
| 52 | Attendant<br>Office - Skate<br>Park    | Ext.      | Service<br>Counter |             |       | Counter > 36" high  | 51"                | Provide a counter that is 36" max. above the ground.   | 1       | 880   | \$880              |
| 53 | Recreation<br>Division                 | 1         | Service<br>Counter | N/A         |       | Counter > 36" high  | 42"                | Provide a counter that is 36" max. above the finished floor.   | 1       | 880   | \$880              |
| 54 | Service<br>Counter - Pro<br>Shop       | 1 217     | Service<br>Counter | N/A         |       | Counter > 36" high  | 39.25"             | Provide a counter that is 36" max. above the finished floor.   | 1       | 880   | \$880              |
| 55 | Near<br>Reception                      | 1         | Service<br>Counter | N/A         |       | Counter > 36" high  | 44.25"             | Provide a counter that is 36" max. above the finished floor.   | 1       | 880   | \$880              |

| ID | Location                                   | Floor | Roon | n Element          | Туре                 | Photo                      | Issues  | Current<br>Measure | Recommendations  | Quantity | Price | Cost<br>Estimation |
|----|--|-------|------|--------------------|----------------------|----------------------------|---|--------------------|--|----------|-------|--------------------|
| 56 | Scudder<br>Family Cafe                     | 1     |      | Service<br>Counter | N/A                  |                            | Counter > 36" high                            | 38"                | Provide a counter that is 36" max. above the finished floor.   | 1        | 880   | \$880              |
|    | Operable Part                              | S     |      | 1                  | _                    |                            | _   |                    | 1  |          |       |                    |
| 57 | Officials -<br>Women's<br>Locker Room      | L     | 112  | Operable<br>Parts  | Clothes<br>Rod/Hooks |                            | Reach < 15" or > 48"(forward/side approach)   | 63"                | Locate at least one coat hook 48" max. above<br>the finished floor.<br>Recommendation applies to all coat hooks at<br>each accessible locker room. | 1        | Labor | \$0                |
| 62 | The United<br>Cultures<br>Resource<br>Room | 1     | 217A | Operable<br>Parts  | Other                |                            | . Reach < 15" or > 48"(forward/side approach) | 57.5"              | Relocate brochures so that they are between 15"- 48" above the finished floor.   | 1        | Labor | \$0                |
| 58 | Teen Center                                | 1     | 210  | Operable<br>Parts  | Clothes<br>Rod/Hooks | LEARNING<br>TOOL<br>SCHOOL | Reach < 15" or > 48"(forward/side approach)   | 78.25"             | Locate at least one coat hook 48" max. above<br>the finished floor.  | 1        | Labor | \$0                |
| 59 | Teen Center                                | 1     | 210  | Operable<br>Parts  | Other                |                            | Reach < 15" or > 48"(forward/side approach)   | 60"                | Relocate pole stick holder so that controls are<br>between 15"- 48" above the finished floor.  | 1        | Labor | \$0                |

| ID | Location                                    | Floor    | Room | n Element                     | Туре                 | Photo | Issues  | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|---|----------|------|-------------------------------|----------------------|-------|---|--------------------|---|----------|-------|--------------------|
| 60 | Coat Hooks -<br>Running<br>Track            | М        |      | Operable<br>Parts             | Clothes<br>Rod/Hooks |       | Reach < 15" or > 48"(forward/side approach)                 | 69.25"             | Locate at least one coat hook 48" max. above the finished floor.  | 1        | Labor | \$0                |
| 61 | Brochure<br>Stand Near<br>Reception<br>Area | 1        |      | Operable<br>Parts             | Other                |       | Reach < 15" or > 48"(forward/side approach)                 | 68"                | Relocate brochures so that controls are between 15"- 48" above the finished floor.  | 1        | Labor | \$0                |
|    | Dining or Wo                                | rk Surfa | ces  |                               |                      |       |   |                    |   |          |       |                    |
| 63 | Teen Center                                 | 1        | 210  | Dining or<br>Work<br>Surfaces | Work<br>Surface      |       | Knee or toe clearance not provided                          | 25.75"             | Adjust at least 1 work surface to ensure 27" min.<br>knee clearance.  | 1        | Labor | \$0                |
|    | Assembly Ar                                 | ea       |      |                               |                      |       |   |                    |   |          |       |                    |
| 64 | Kennedy Ice<br>Rink                         | 1        | 101  | Assembly<br>Area              | N/A                  |       | Number of seats<br>Assistive listening devices not provided | 1493<br>-          | If audible communication is integral to the use of<br>the space, provide an assistive listening system.<br>(Cost for assistive listening system is based on<br>the seating capacity.) | 1        | 9865  | \$9865             |
| 65 | Conference<br>Room                          | 1        | 232  | Assembly<br>Area              | N/A                  |       | Number of seats<br>Assistive listening devices not provided | 12<br>-            | If audible communication is integral to the use of<br>the space, provide an assistive listening system.<br>(Cost for assistive listening system is based on<br>the seating capacity.) | 1        | 1214  | \$1214             |

| ID | Location   | Floor | Room        | n Element        | Туре    | Photo | Issues   | Current<br>Measure   | Recommendations C  | Quantity | Price | Cost<br>Estimation |
|----|--|-------|-------------|------------------|---------|-------|--|----------------------|--|----------|-------|--------------------|
| 66 | Lower level<br>Seating -<br>Kennedy Ice<br>Rink  | L     | 101         | Assembly<br>Area | N/A     |       | Wheelchair spaces < 36" x 48" (if front entrance)  | -                    | Provide a 36" min. by 48" min. clear floor space<br>with 12" shoulder alignment with adjacent bench.<br>Note: Ensure a total of 16 accessible wheelchair<br>spaces are provided with 36" min. by 48" min.<br>clear floor space having 12" shoulder alignment<br>with adjacent bench.   | 16       | -     | \$0                |
|    | Locker Room                                      |       |             |                  | 1       |       |  |                      |  |          |       |                    |
| 67 | Locker 1-1 &<br>Locker 1-4                       | L     |             | Locker<br>Room   | Other   |       | Total # of locker<br>Total # of accessible locker<br>Storage > 48" high<br>Hook > 48" high   | 26<br>2<br>-<br>-    | Locate the shelf at the accessible lockers no<br>higher than 48 inches max. above the finished<br>floor.<br>Locate hook no higher than 48" above the<br>finished floor.<br>(Cost of 2 locker rooms are included in pricing.)   | 4        | Labor | \$0                |
| 68 | Officials -<br>Women's &<br>Men's Locker<br>Room | L     | 112,<br>113 | Locker<br>Room   | Women's |       | Total # of locker<br>Storage > 48" high<br>Non-compliant hardware<br>Hook > 48" high         | 6<br>68"<br>-<br>65" | Ensure that at least one (1) locker is accessible,<br>and no higher than 48 inches above the floor.<br>Provide hardware that can be operable with one<br>hand and not require tight grasping, pinching, or<br>twisting of the wrist.<br>Locate hook no higher than 48" above the<br>finished floor.<br>(Cost of 2 locker rooms are included in pricing.) | 2        | 680   | \$1360             |
| 69 | Locker 1-1 &<br>Locker 1-4                       | L     |             | Locker<br>Room   | Other   |       | Clear floor space not provided<br>30" clear not provided alongside bench<br>Bench < 24" deep | -<br>-<br>15"        | Relocate bench to provide a 30" min. by 48" min.<br>clear floor space at accessible lockers.<br>Provide a 30" min. by 48" min. clear space<br>along the side of the bench so that wheelchair<br>users can transfer.<br>Provide a bench that is 24" deep.<br>(Cost of 2 locker rooms are included in pricing.)  | 2        | 200   | \$400              |
| 70 | Locker 1-2 &<br>Locker 1-3                       | L     |             | Locker<br>Room   | Other   |       | Bench < 24" deep<br>Hook > 48" high  | 15"<br>-             | Provide a bench that is 24" deep.<br>Locate hook no higher than 48" above the<br>finished floor.<br>Note: If any changes are made to layout, ensure<br>a 30" min. by 48" min. clear space along the side<br>of the bench so that wheelchair users can<br>transfer.<br>(Cost of 2 locker rooms are included in pricing.)                                  | 2        | 200   | \$400              |

Toilet & Bathing Rooms

| ID | Location  | Floor | Room | Element  | Туре | Photo | Issues                              | Current<br>Measure | Recommendations  | Quantity | Price | Cost<br>Estimation |
|----|---|-------|------|----------|------|-------|-------------------------------------|--------------------|--|----------|-------|--------------------|
|    | Lavatory  |       |      |          |      |       |                                     |                    |  |          |       |                    |
| 71 | Women's<br>Toilet Room<br>Near Shepley<br>Community<br>Room | 1     | 230  | Lavatory | N/A  |       | Toe or knee clearances not provided | 25.25"             | Provide at least one lavatory with knee and toe clearance positioned for a forward approach. | 1        | 1686  | \$1686             |
| 72 | Boys' Toilet<br>Room - Teen<br>Center                       | 1     | 214  | Lavatory | N/A  |       | Toe or knee clearances not provided | 25"                | Provide at least one lavatory with knee and toe clearance positioned for a forward approach. | 1        | 1686  | \$1686             |
| 73 | Girls' Toilet<br>Room - Teen<br>Center                      | 1     | 215  | Lavatory | N/A  |       | Toe or knee clearances not provided | 24.5"              | Provide at least one lavatory with knee and toe clearance positioned for a forward approach. | 1        | 1686  | \$1686             |
| 74 | Lavatories at<br>Locker Room<br>1-1                         | L     | 123  | Lavatory | N/A  |       | Toe or knee clearances not provided | 25"                | Provide at least one lavatory with knee and toe clearance positioned for a forward approach. | 1        | 1686  | \$1686             |
| 75 | Lavatories at<br>Locker Room<br>1-4                         | L     | 137  | Lavatory | N/A  |       | Toe or knee clearances not provided | 24.5"              | Provide at least one lavatory with knee and toe clearance positioned for a forward approach. | 1        | 1686  | \$1686             |

| ID | Location  | Floor | Room | n Element | Туре | Photo | Issues  | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|---|-------|------|-----------|------|-------|---|--------------------|---|----------|-------|--------------------|
| 76 | Women's<br>Toilet Room<br>Near Scudder<br>Family Cafe | 1     | 225  | Lavatory  | N/A  |       | Toe or knee clearances not provided<br>Plumbing underneath is exposed | 25.75"<br>-        | Provide at least one lavatory with knee and toe<br>clearance positioned for a forward approach.<br>Insulate or otherwise configure pipes to prevent<br>contact for at least one lavatory. | 1        | 1778  | \$1778             |
| 77 | Women's<br>Toilet Room                                | L     | 118  | Lavatory  | N/A  |       | Toe or knee clearances not provided<br>Plumbing underneath is exposed | 24.75"<br>_        | Provide at least one lavatory with knee and toe<br>clearance positioned for a forward approach.<br>Insulate or otherwise configure pipes to prevent<br>contact for at least one lavatory. | 1        | 1778  | \$1778             |
| 78 | Men's Toilet<br>Room                                  | L     | 119  | Lavatory  | N/A  |       | Toe or knee clearances not provided<br>Plumbing underneath is exposed | 24.75"<br>-        | Provide at least one lavatory with knee and toe<br>clearance positioned for a forward approach.<br>Insulate or otherwise configure pipes to prevent<br>contact for at least one lavatory. | 1        | 1778  | \$1778             |
| 79 | Toilet -<br>Locker 1-2<br>and 1-3                     | L     | 130  | Lavatory  | N/A  |       | Toe or knee clearances not provided<br>Plumbing underneath is exposed | 24.75"             | Provide at least one lavatory with knee and toe<br>clearance positioned for a forward approach.<br>Insulate or otherwise configure pipes to prevent<br>contact for at least one lavatory. | 1        | 1778  | \$1778             |
| 80 | Men's Toilet<br>Room Near<br>Scudder<br>Family Cafe   | 1     | 224  | Lavatory  | N/A  |       | Plumbing underneath is exposed  | -                  | Insulate or otherwise configure pipes to prevent contact for at least one lavatory.   | 1        | 92    | \$92               |

| ID | Location  | _      | Room        | Element                   | Туре                          | Photo | Issues                                     | Current<br>Measure | Recommendations  | Quantity | Price | Cost<br>Estimation |
|----|---|--------|-------------|---------------------------|-------------------------------|-------|--|--------------------|--|----------|-------|--------------------|
|    | Single-User T   | oilet  |             |                           |                               |       |  |                    |  |          |       |                    |
| 81 | Girls' Toilet<br>Room - Teen<br>Center  | 1      | 215         | Single-User<br>Toilet     | N/A                           |       | . Hook located > 48" high                  | 66.25"             | Locate coat hook no higher than 48" above the finished floor.                      | 1        | Labor | \$0                |
|    | Toilet Compa  | rtment |             |                           |                               |       |  |                    |  |          |       |                    |
| 82 | Women's<br>Toilet Room<br>Near Scudder<br>Family Cafe<br>& Near<br>Shepley<br>Community<br>Room | 1      | 225,<br>230 | Toilet<br>Compartme<br>nt | Accessible<br>Compartme<br>nt |       | Door has malfunctioning self-closing hinge | -                  | Repair hinge at ambulatory and accessible compartments.                            | 3        | Labor | \$0                |
| 83 | Accessible<br>Toilet Room<br>at Locker 1-2<br>and 1-3   | L      | 130         | Toilet<br>Compartme<br>nt | Accessible<br>Compartme<br>nt |       | Door has malfunctioning self-closing hinge | -                  | Repair hinge.  | 1        | Labor | \$0                |
| 84 | Men's Toilet<br>Room Near<br>Shepley<br>Community<br>Room                                       | 1      | 231         | Toilet<br>Compartme<br>nt | Accessible<br>Compartme<br>nt |       | Clearance at toilet < 60" clear width      | 54"                | Relocate partition to ensure a 60" min. width clearance is provided at the toilet. | 1        | 256   | \$256              |
| 85 | Women's<br>Toilet Room<br>Near Scudder<br>Family Cafe   | 1      | 225         | Toilet<br>Compartme<br>nt | Accessible<br>Compartme<br>nt |       | Centerline < or > 18" (MAAB)               | 16"                | Relocate toilet so the centerline is 18" from the side wall.                       | 1        | 2828  | \$2828             |

| ID | Location Floo   | r Roor | n Element                     | Туре             | Photo | Issues  | Current<br>Measure | Recommendations  | Quantity | Price | Cost<br>Estimation |
|----|---|--------|-------------------------------|------------------|-------|---|--------------------|--|----------|-------|--------------------|
|    | Shower Compartm   | ent    |                               |                  |       |   |                    |  |          |       |                    |
| 86 | Shower L<br>Compartment<br>at Locker 1-2<br>and 1-3                 |        | Shower (<br>Compartme<br>nt   | Dther            |       | Clear space at transfer shower > 48" x 36"                                | -                  | Ensure a 36" min. by 48" min. clear floor space<br>measured from the control wall is provided at the<br>transfer shower.   | 1        | Labor | \$0                |
| 87 | Officials - L<br>Women's<br>Locker Room                             | 112    | Shower 7<br>Compartme 7<br>nt | Transfer<br>Type |       | Grab bars not provided  | -                  | Provide two 30 inch grab bars, one on the back wall and one on the wall opposite the seat.   | 1        | 898   | \$898              |
| 88 | Officials - L<br>Men's Locker<br>Room                               | 113    | Shower (<br>Compartme<br>nt   | Dther            |       | Grab bars not provided<br>Seat not provided (transfer compartment)        | -                  | Provide two 30 inch grab bars, one on the back<br>wall and one on the wall opposite the seat.<br>Provide a padded folding seat on the wall<br>opposite the shower control. | 1        | 1498  | \$1498             |
| 89 | Shower L<br>Compartment<br>- Locker<br>Room 1-1, 1<br>-2 & 1-3, 1-4 |        | Shower (<br>Compartme<br>nt   | Dther            |       | Shower head not fixed at 48" above finished floor                         | -                  | Provide a fixed shower head at 48" above<br>finished floor that can be used both as a fixed<br>shower head and as a hand-held shower.                                      | 3        | 638   | \$1914             |
|    | Portable Toilet   |        |                               |                  |       |   |                    |  |          |       |                    |
| 90 | Portable Ext.<br>Toilet Near<br>Skate Park                          |        | Portable N<br>Toilet          | J/A              |       | Not located on an accessible route<br>60" by 72" clear space not provided | -                  | Locate portable toilet on an accessible route.<br>Provide an accessible portable toilet that has 60"<br>wide and 72" deep at the toilet.                                   | 1        | -     | \$0                |

| ID | Location  | Floor  | Room | n Element             | Туре                     | Photo | Issues   | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|---|--------|------|-----------------------|--------------------------|-------|--|--------------------|---|----------|-------|--------------------|
|    | Drinking Four   | ntains |      |                       |                          |       |  |                    |   |          |       |                    |
| 91 | Water<br>Fountain by<br>Women's<br>Toilet Room -<br>Lower Lobby | L      | 103  | Drinking<br>Fountains | Low                      |       | Operable parts malfunctioning<br>No drinking fountain provided for standing users  | -                  | Repair spout.<br>Provide an additional drinking fountain for<br>standing users.   | 1        | 4028  | \$4028             |
| 92 | Water<br>Fountain by<br>Men's Toilet<br>Room -<br>Lower Lobby   | L      | 103  | Drinking<br>Fountains | N/A                      |       | No drinking fountain provided for standing users   | -                  | Provide an additional drinking fountain for standing users.   | 1        | 4028  | \$4028             |
|    | Sink  |        |      |                       |                          |       |  |                    |   |          |       |                    |
| 93 | Shepley<br>Community<br>Room                                    | 1      | 227  | Sink                  | Other                    |       | Toe and knee clearances not provided<br>Rim or counter > 34"<br>Exposed plumbing underneath sink   | 23"<br>36"<br>-    | Ensure there is a 27" knee clearance positioned<br>for a forward approach.<br>Relocate sink with the front of the rim or counter<br>no higher than 34".<br>Insulate or otherwise configure pipes at sink. | 1        | 4872  | \$4872             |
| F  | Play and Sport  | Areas  |      |                       |                          |       |  |                    |   |          |       |                    |
|    | Rink  |        |      |                       |                          |       |  |                    |   |          |       |                    |
| 94 | Team<br>Seating -<br>Kennedy Ice<br>Rink                        | L      | 101  | Rink                  | Indoor Ice<br>Skate Rink |       | No accessible spaces provided at team seating area<br>No accessible spaces provided at sidelines seating<br>Not connected to an accessible route | -                  | Providing an accessible team seating that is<br>connected to an accessible route might be<br>technically infeasible.  | 2        | -     | \$0                |

| ID | Location   | Floor | Room | n Element | Туре                     | Photo                    | Issues                               | Current<br>Measure | Recommendations   | Quantity | Price | Cost<br>Estimation |
|----|--|-------|------|-----------|--------------------------|--------------------------|--------------------------------------|--------------------|---|----------|-------|--------------------|
| 95 | Entrance to<br>Rink From<br>Team<br>Seating -<br>Kennedy Ice<br>Rink | L     | 101  | Rink      | Indoor Ice<br>Skate Rink | Puth<br>pckton<br>way co | Not connected to an accessible route | -                  | Providing an accessible team seating that is<br>connected to an accessible route might be<br>technically infeasible.                  | 1        | -     | \$0                |
| 96 | Penalty Box ,<br>Press Box -<br>Kennedy Ice<br>Rink                  | L     | 101  | Rink      | Indoor Ice<br>Skate Rink |                          | Not connected to an accessible route | -                  | Providing an accessible seating that is connected to an accessible route might be technically infeasible.                             | 1        | -     | \$0                |
| В  | est Practice   |       |      |           |                          |                          |                                      |                    |   |          |       |                    |
| 97 | Stair Near<br>Scudder<br>Family Cafe                                 | 1     |      |           |                          |                          |                                      |                    | Recommend adding contrasting strips at the edge of each step at all the stairs.   | 1        | -     | \$0                |
| 98 | Entrance<br>Kennedy Ice<br>Rink Near<br>Scudder<br>Family Cafe       | 1     |      |           | 263                      |                          |                                      | -                  | Provide a sign with the International Symbol of Accessibility (ISA).  | 1        | -     | \$0                |
| 99 | Exit West of<br>Kennedy Ice<br>Rink                                  | L     | 101  |           | 151                      |                          |                                      | -                  | If the exit sign is replaced with an illuminated exit<br>sign, provide an illuminated International Symbol<br>of Accessibility (ISA). | 1        | -     | \$0                |

| ID  | Location   | Floor | Room | n Element | Туре | Photo   | Issues Current<br>Measure                            | Recommendations Quan  | tity Price | Cost<br>Estimation |
|-----|--|-------|------|-----------|------|---|--|---|------------|--------------------|
| 100 | Benches<br>Along Path<br>Near South of<br>Bassett Lane | Ext.  |      |           |      |   |  | Recommend providing a 36" min. x 48" min. 1<br>clear floor space adjacent to the bench.                     | -          | \$0                |
| 101 | Lantern -<br>Shepley<br>Community<br>Room              | 1     | 227  |           | 300  |   | -  | Provide an adjustable lantern with 27" min. knee 1<br>and toe clearance.                                    | -          | \$0                |
| 102 | Entrance<br>Kennedy Ice<br>Rink                        | L     | 103  |           | 263  |   |  | Provide a sign with the International Symbol of Accessibility (ISA).  | -          | \$0                |
| 103 | Entrance<br>Butler Ice<br>Rink                         | L     | 103  |           | 263  | PATRICK M. BUTLER<br>SKATING RINK   |  | Provide a directional sign indicating the location 1 of the nearest accessible entrance.                    | _          | \$0                |
| 104 | Teen Center<br>Entrance/Exit                           | 1     | 210  |           | 266  | HIS BEAR ON DAY PASS NEEDED FOR ENTRY<br>DAY PASSES ARE SOLD DOWNSTAIRS<br>IN THE SKALE DESTRICTION | Non glare finish and contrast not provided on sign - | Install a sign with a non-glare finish with 1<br>characters that have a high contrast to the<br>background. | -          | \$0                |